




Carbide 3D

Keyboard Shortcuts for Carbide Motion

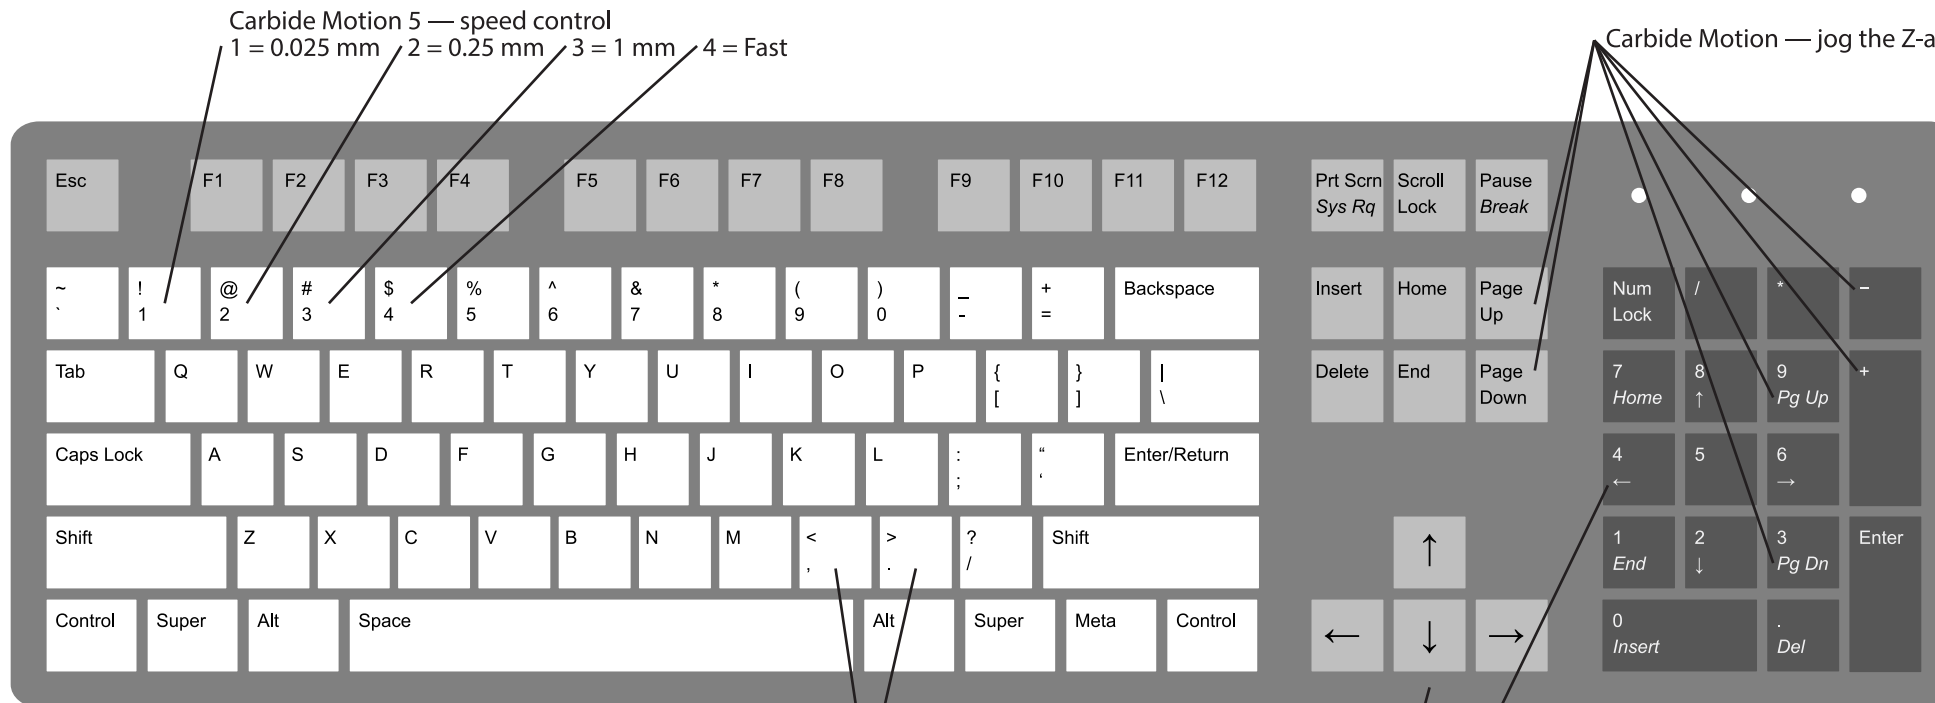

Carbide Motion 5 — speed control
1 = 0.025 mm 2 = 0.25 mm 3 = 1 mm 4 = Fast

Carbide Motion — jog the Z-axis

Carbide Motion — speed control

- 1 0.025mm
- 2 0.25mm
- 3 1 mm
- 4 Fast

Carbide Motion — jog the Z-axis

Carbide Motion — Arrow keys jog in the X/Y plane

