Carbide 3D Keyboard Shortcuts for Carbide Create and Motion

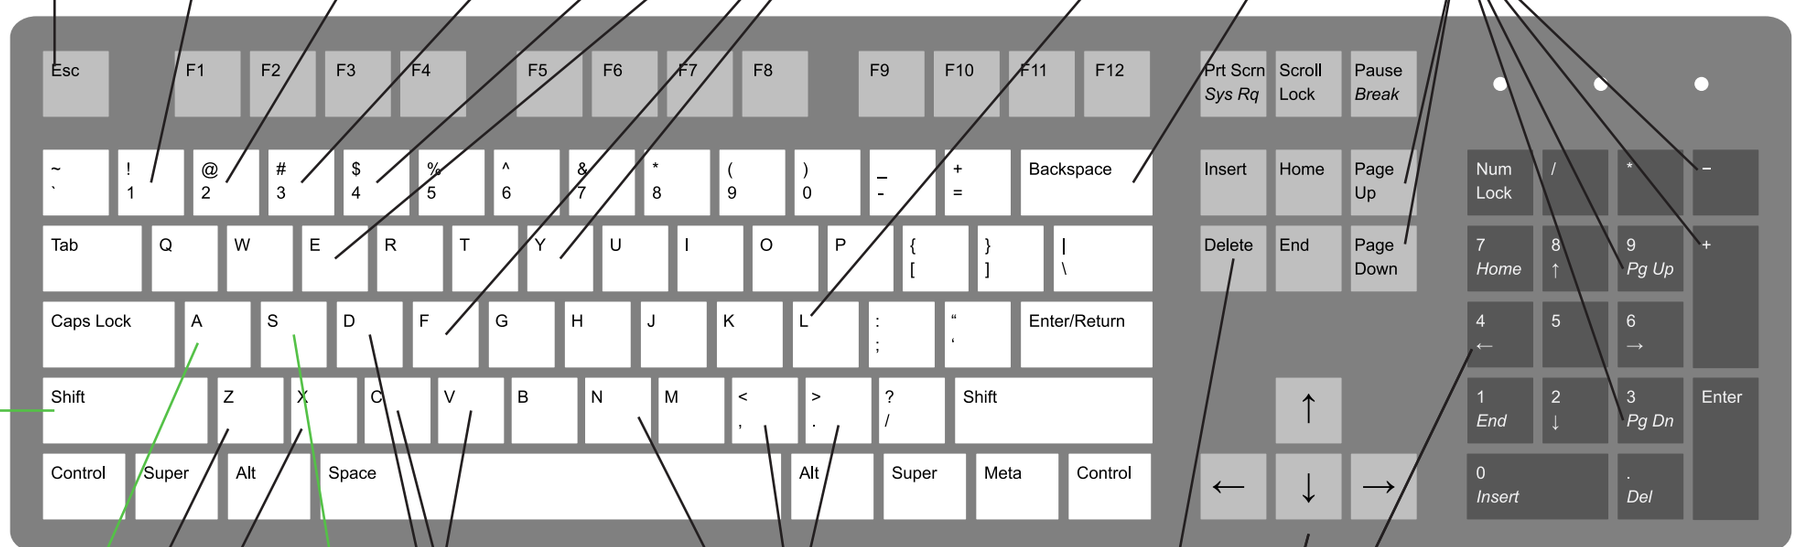

Carbide Create — deselects and returns to current pane

Carbide Create — (615 and later) Show Library (E)lements

Carbide Create —resets view
ctrl f resets view to stock only

Carbide Create — (521 and later) Layer window

Carbide Create (Mac OS X) — function backspace will delete the current selection

Carbide Motion 5 — speed control
1 = 0.025 mm 2 = 0.25 mm 3 = 1 mm 4 = Fast

Carbide Create — control
(command) z Redo

Carbide Motion — jog the Z-axis

Carbide Motion — speed control

1 0.025mm
2 0.25mm
3 1 mm
4 Fast

Carbide Create — control
(command) c copy
the current selection v paste

Carbide Create — control
(command) d duplicate
the current selection. Node edit
delete selected nodes

Carbide Motion — jog the Z-axis

Carbide Create (473 or later)
— enter/exit Node Edit mode

Carbide Create — node edit
toggle smooth/sharp

Carbide Create — control (command) x delete the current selection

Carbide Create — control (command) z Undo

Carbide Create — control (command) a will select everything

Carbide Create — shift- (414 and later) or control- (413 and earlier) clicking on geometry
will add or remove it from the current selection

Carbide Motion — Arrow
keys jog in the X/Y plane
Create — nudge selection

Carbide Create — delete will delete the current selection

Carbide Create —
click-hold-drag on
empty area to select
dragging up will select
any object even partially
in the selection area,
down will only select
objects entirely within
the marquee

click-hold dragging on
a selection will move
it (with snapping
if enabled)

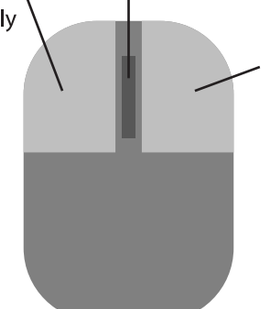

Carbide Create — Zoom in/out in
design/3D preview.

Carbide Create —
click-hold-drag on
empty area to pan

right-click (or control-
click on toolpaths or
group headings in
the Toolpath pane
for a menu which allows
deletion, or on paths
while node editing for
options.